'A d d t!i,D ADT 680 Digital Pressure Gauge ---- User•s Manual

[Version No.: 2006V15]

(**E**Addited Corporation

ullet

CONTENTS

1. Introduction	
2. Basic structure	1
3. Keypad	2
4. Display	3
5. Start-up screen	3
6. Menu setup and configuration	4
7. Calibration	8
8. Troubleshooting	12
9. Custom Unit Entry	
10. Specifications	15
11. Warning	19
12. FCC Declaration of Conformity	20
13. Battery installation	
14. Ordering information	
15. Appendix I– Data logging	24




1 Introduction

The ADT680 digital pressure gauge is a rugged wireless data logging pressure gauge that can log in real time, or data which can be stored and downloaded later via wireless communication. The compact industrial design and advanced technology makes the ADT680 as an ideal pressure measurement tool. The ADT680 combines a variety of accuracy levels with a robust IP67 water-and-dust proof casing. It can be used either as a pressure reference or an applications where high accuracy measurement is required.

2 Basic structure









3 keypad

Pressure display:

Push the button->Switch engineering units Push and hold the button->Enter menu setup mode

Menu setup mode:

Push the button->Move forward through menus / Highlight shift right Pressure display:

Push the button->Backlight on/off Push and hold the button->Min/Max value

Menu setup mode:

Push the button->Move backward through menus /Number incrementing



Pressure display:

Push and hold the button->Turns power on/off

Menu setup mode:

Push the button->Go back/Cancel

Pressure display:


Push the button->Pressure zero Push and hold the button->Lock/Unlock

Key


Menu setup mode: Push the button->Enter/Make selection

Addite 680 Digital Pressure Gauge

4 Display

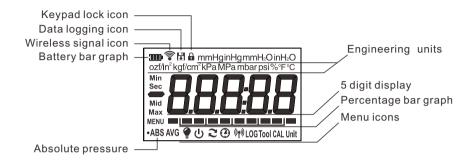


5 Start-up screen

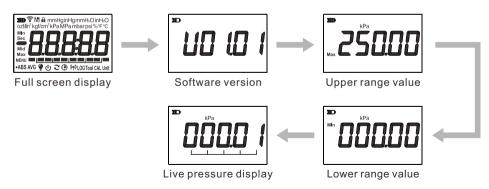


 \bullet



6 Menu setup and configuration

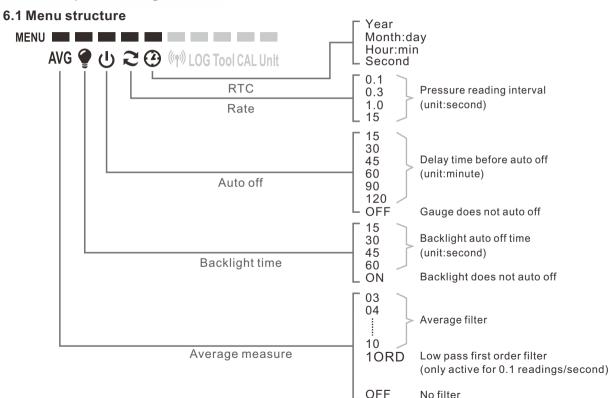



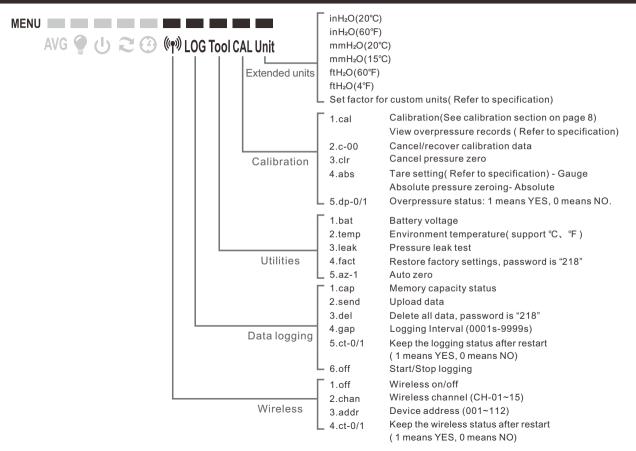




6.2 Menu operation

6.2.1 Enter/Return

Push and hold button in the pressure display mode to enter menu setup mode.

Push to button in menu setup mode to return to previous menu.

Example:

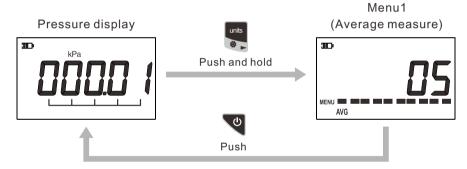

6.2.2 Switch menu item

Push and button to move forward or backward through the menus:



Addite 680 Digital Pressure Gauge




Example:

Move menu1(Average measure) forward to menu2(Backlight setup)

6.2.3 Submenu setup

Push to access submenu setup, push or to view options, then push to select an option, or push to recover former option.

Example:

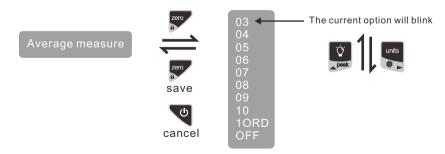

Addite 680 Digital Pressure Gauge



6.2.4 Number inputting introduction

- Highlight shift right
- If number incrementing exceeds the maximum display, it will return to 0
- Confirm the inputted number
- (ESC)Cancel the inputted number

If need to input minus sign "-", push and hold we button.

7 Calibration

It is recommended that the ADT680 be calibrated annually in a lab traceable to national standards.

We recommend finding a lab that can offer uncertainties 4 times better than the accuracy of the gauge being tested. We also recommend that, in order to achieve the best calibration results and prior to calibrate the ADT680, it should be pressurized to full scale and back to zero three times.

7.1 Calibration conditions

Note: Please make sure during calibration the following conditions are met.

- (1) Environment:Temperature: 22°C ±3°C; Relative humidity: (45-75) %; Atmosphere pressure: (86~106) kPa.
- (2) Equipment: Standard pressure source and indicator have a test uncertainty ratio (TUR) of 4:1 or better.



7.2 Calibration Points

- (1) Single scale gauge: We recommend at least two pressure calibration points should be used when calibrating the 680 gauge. Usually at 0 and 100% of full scale(Vacuum gauge should use vacuum point).
- (2) Compound pressure gauge: We recommend at least a three points calibration. Usually points will include low end vacuum point, 0 and 100% of full scale.

The calibration points can be changed to meet your requirements, only if it meets the following conditions:

- (1) The first point should be smaller than the second point.
- (2) The second point should be smaller than the third point.



7.3 Calibration Process

For a calibration example we will use a (0~100) kPa gauge.

(1) Access the calibration menu in Menu setup mode(refer to Menus operation section), Figure 1 will display on the screen. Next push button to enter Menu setup, Figure 2 will be displayed. Input password"218"(refer to Number inputting introduction section) as in Figure 3, and push button to continue, Figure 4 will be shown.



Figure1



Figure2




Figure3




Figure4

(2) Select and push , the screen will display the lower range of this gauge as shown in Figure 5. The first digit will blink which allows the user to configure the calibration point by inputting the desired pressure value. If no adjustment is needed, just push to continue;





Flashing,input new calibration point Figure5



The actual pressure measurement value Figure6



Flashing, input new calibration point Figure 7



The actual pressure measurement value Figure8


- (3) To calibrate the lower range point: Use the pressure source to control the lower range pressure, for this example 0 kPa is the lower point. After the reading is stable, push to confirm, then the screen will prompt the user for the next calibration point, which in this example is 100kPa (the upper range), as shown in Figure 7. User can also change this calibration point by inputting the desired value. If there is no need to adjust, push to continue.
- (4) To calibrate upper range point: Use the pressure source to control the upper range pressure, 100 kPa. After the reading is stable push to confirm, then the screen should be shown as in Figure 9, which means the calibration procedure is completed.


Remark: To calibrate a compound pressure gauge, use almost the same procedures as the above. There is one more point need. When checking zero, the icon **Mid** will be displayed on the screen.



7.4 Cancel Calibration

Access the second function **2** - **1** of the calibration menu, as shown in Figure 9. Then push the button , the screen should be shown as Figure 10, which means the calibration has been canceled.

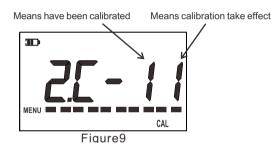

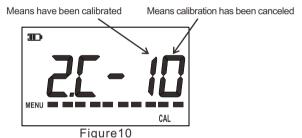

8 Troubleshooting

ERR1 displayed: Beyond zeroing range of 2%FS

ERR2 displayed: Sensor data out of limit, contact Additel Corporation

ERR3 displayed: Sensor damaged, contact Additel Corporation



9 Custom Unit Entry

- (1) Press and hold key to enter the menu.
- (2) Press key until you see TOOL at the bottom. Then press to enter the TOOL menu.
- (3) Press key until you see 5.COE and press Now you should see the custom factor (Number x kPa). The default number is 1.
- (4) Press again to adjust the number. Now you should see 00001 with the first zero flashing.

 The flashing number is what can be adjusted. Note that at this point we are not modifying the decimal, just the main integers (i.e. ones, tens, etc). The decimal adjustment will be step 6.
- (5) Use key to scroll to the desired number. Then use the BACK LIGHT key to sequence the number up. When you have the desired number press to enter the value.
- (6) Now you will see 0.0000 with the first decimal flashing. Adjust the number in the same way as step 5 and press to accept the value.
- (7) Now you should see the adjusted value on the display. This is the custom unit factor.
 Important Note: If the value returns to the default number of 1, then it is likely the value you tried to enter is not supported by the 5-digit resolution of the gauge. For example, the



resolution is only 5 digits, so the max any gauge can display is 99999. If you have a 100 kPa (GP15) gauge and put a custom unit of 900 then the custom will be accepted because the max pressure of this gauge would display as 90000 (100 kPa x 900). But if you try and program 1000 as my custom unit it will not be accepted because the max value would be above the 5 digit resolution (100 kPa x 1000 = 100000 kPa).

- (8) To display the custom unit exit back to the main display. Press and hold key to enter the menu and scroll over to menu. Press to enter the menu. By pressing key you can cycle through the engineering units available. When you reach your custom unit, the whole number will be flashing. To accept this press and exit out to the main display.
- (9) Press key to cycle through the unit selections available. The custom unit is indicated by the Unit icon in the bottom right of the display.

10 Specifications

Pressure Ranges

Gauge Pro	Gauge Pressure				
P/N	Pressure range (psi) ¹	Pressure range (bar)	Media²	Accuracy (%FS)	Burst Pressure
V15	-15	-1.0	G, L	0.05 (0.1, 0.25)	3X
GP15	15	1.0	G, L	0.05 (0.1, 0.25)	3X
GP30	30	2.0	G, L	0.05 (0.1, 0.25)	3X
GP100	100	7.0	G, L	0.05 (0.1, 0.25)	3X
GP300	300	20	G, L	0.05 (0.1, 0.25)	3X
GP500	500	35	G, L	0.05 (0.1, 0.25)	3X
GP1K	1,000	70	G, L	0.05 (0.1, 0.25)	3X
GP3K	3,000	200	G, L	0.05 (0.1, 0.25)	3X
GP5K	5,000	350	G, L	0.05 (0.1, 0.25)	3X
GP10K	10,000	700	G, L	0.05 (0.1, 0.25)	2X
GP15K	15,000	1,000	G, L	0.05 (0.1, 0.25)	2X
GP25K	20,000	1,600	G, L	0.1(0.25)	1.5X
GP30K	30,000	2,000	G, L	0.1(0.25)	1.5X
GP36K	36,000	2,500	G, L	0.1(0.25)	1.5X
Compoun	Compound Pressure				
P/N	Pressure range (psi) ¹	Pressure range (bar)	Media²	Accuracy (%FS)	Burst Pressure
CP15	± 15	±1	G	0.05 (0.1, 0.25)	3X
CP30	-15 to 30	-1 to 2	G	0.05 (0.1, 0.25)	3X

Note: [1]. Sealed gauge pressure for above 1,000 psi

[2].G=Gas,L=Liquid(please specify media type when placing order)



Performance			
Recommended calibration period	One year		
Update rate	10/Sec、3/Sec (default)、1/Sec、1/15Sec		
Operating temperature	-10°C~50°C Guaranteed accuracy		
Overload pressure	1.2X		
	Power Supply		
Battery	2 x AA alkaline (LR6) batteries Recommend: Duracell MX1500、EnergizerE91、Panasonic LR6、GP 15AU		
Battery life	10/Sec:1,500 Hours、3/Sec:3,000 Hours、1/Sec:6,000 Hours、1/15Sec:12,000 Hours		
Rated Power			
Rated	3.0 VDC Imax=30 mA Pmax=90 mW		
Material			
Wetting parts	Wetted surface: All wetted surfaces are 316L stainless steel with welded design for gauges ≤10,000 psi (no O-ring, thread tape, epoxy, or sealant on any part of the sensor assembly), and copper O-ring design for gauges > 10,000 psi.		
Case	PC+ABS		
Protecting cover	Silicone Rubber		



Display			
LCD specification	FSTN-LCD,Visual scope 36 x 61 mm; Full 5 digit,15.2 mm High; 7-segment analog bargraph scaled to 0~100% of FS		
Backlight	White		
Wireless Communication(optional)			
Wireless frequency	2.4G ISM Bands, 20 meter range		
Number of channels	15		
Software	Additel/Land software available for free download at www.additel.com. Additel/Log II Wireless available for purchase.		
	Storage		
Storage capacity	140,000 records, recorded contents include time, pressure and temperature		
Storage interval	1~9999Sec, user selectable		
Certificates			
Certificates	CER&TTE、FCCID、ICID		
Protection level	IP67		
Vibration	5g (20~2,000Hz)		
Shock resistance	100g/11ms		



Others		
Dimensions	Ф100 mm x 40 mm, total height: 157 mm (4" x 1.6" x 6.2")	
Weight	500 g (1.1 lbs)	
Fitting	1/4 NPT, 1/2 NPT, 1/4BSP, M20×1.5, autoclave (male or female)or custom-made	
Additional functions		
Auto off	Disabled、15、30、45、60、90、120 minutes, user selectable.	
Filtering	Averaging (3 to 10 samples) or low-pass first-order filter.	
Engineering units	Pa, kPa, mPa, bar, mbar, psi, kgf/cm², mmH ₂ O, mmHg, inH ₂ O, inHg, ozf/in², %, °C, °F Extend units: inH ₂ O(20°C), inH ₂ O(60°F), mmH ₂ O(20°C), mmH ₂ O(15°C), ftH ₂ O(60°F), ftH ₂ O(4°C) This allows users to set a multiplier factor to be multiplied by the kPa measured pressure. For example: $2 \text{ kPa} = 0.02 \text{ bar } (2*0.01)$, factor: 0.01 , a 2 kPa pressure will display as 0.02 . (ADT680 can be set by the factory or via the Land/Wireless software))	
Backlight duration	Disable auto off,15,30,45,60 seconds , user selectable	
Max/Min data capture	Capture the Max and Min data during pressure measurement	
Key lockout	To avoid mis-operations. When the gauge is in auto-storing status, buttons will be locked automatically.	
Overpressure alarm	Display will flash over 120%FS	
Battery voltage measurement	To measure and display the battery voltage. When the battery voltage is too low, gauge will be power-off automatically.	



	Additional functions
Overpressure records	View the 5 most recent over pressure records by inputting pass word "888" in the Calibration menu, when screen is shown as Figure 2, Page10.
Leakage test	Detect pressure leakage over a period of time. The gauge will auto-record beginning pressure value, ending pressure value and leakage $\Delta \text{P}.$
Factory reset	Reset all the settings back to factory default settings, except for the calibration parameter.
Automatic zeroing	Once automatic zeroing function is activated, the measured value is less than 0.01% of full scale, and this situation maintains more than 10 seconds, the gauge will automatically zero.
Tare/Offset reading	This function can be used to subtract a constant value from the measured pressure. For example: If the tare or offset point is set to 50 psi, and the measured pressure is 80 psi, then 30 psi will be displayed.

11 Warning

- Remaining battery life is displayed, if the gauge automatically power off, please replace a new battery
- To prevent a dangerous pressure release, isolate and bleed the system before disconnecting a pressure connection.
- Do not change the any of the components or inside structure of this gauge;
- To prevent damage, do not use ADT680 for long periods of time in an over pressure condition;



12 FCC Declaration of Conformity

Changes or modifications not expressly approved by the party responsible for compliance could void the user's authority to operate the equipment.

This device complies with part 15 of the FCC rules. Operation is subject to the following two conditions:

- (1) This device may not cause harmful interference, and
- (2) this device must accept any interference received, including interference that may cause undesired operation

FCC & IC Radiation Exposure Statement: this equipment complies with FCC radiation exposure limits set forth for an uncontrolled environment and meets the exemption from the routine evaluation limits in section 2.5 of RSS 102.

This device complies with Industry Canada license-exempt RSS standard(s). Operation is subject to the following two conditions:

- (1) this device may not cause interference, and
- (2) this device must accept any interference, including interference that may cause undesired operation of the device.

Le présent appareil est conforme aux CNR d'Industrie Canada applicables aux appareils radio exempts de licence. L'exploitation est autorisée aux deux conditions suivantes :

- (1) l'appareil ne doit pas produire de brouillage, et
- (2) l'utilisateur de l'appareil doit accepter tout brouillage radioélectrique subi, même si



This equipment has been tested and found to comply with the limits for a Class B digital device, pursuant to part 15 of the FCC rules.

These limits are designed to provide reasonable protection against harmful interference in a residential installation.

This equipment generates, uses and can radiate radio frequency energy. If not installed and used in accordance with the instructions, may cause harmful interference to radio communications. However, there is no guarantee that interference will not occur in a particular installation.

If this equipment does cause harmful interference to radio or television reception, which can be determined by turning the equipment off and on, the user is encouraged to try to correct the interference by one or more of the following measures:


- —Reorient or relocate the receiving antenna.
- —Increase the separation between the equipment and receiver.
- —Connect the equipment into an outlet on a circuit different from that to which the receiver is connected.
- —Consult the dealer or an experienced radio/TV technician for help.


This device complies with part 15 of the FCC rules. Operation is subject to the following two conditions:

- (1) This device may not cause harmful interference, and
- (2) this device must accept any interference received, including interference that may cause undesired operation.



13 Battery installation

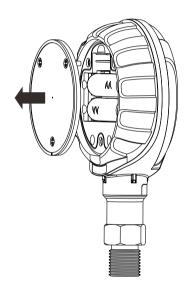


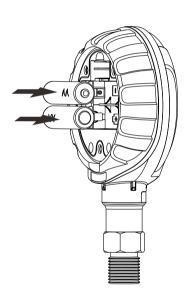



14 Ordering information

Model Number

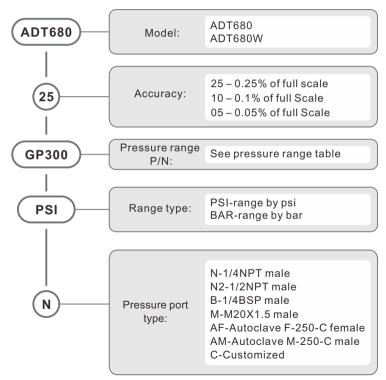

NOTE: ADT680W with wireless and data logging

Accessories(included)

AA alkaline(LR6)battery(2 pc)

Manual

NIST traceable calibration certificate Model 9253 Rubber protective boot Additel/Land Wireless software for 680W (free download at www.additel.com)

Optional Accessories

Model number	Description
9503	Additel/Log II Wireless real time data logging and graphical software for 680W
9030	Spare wireless master device (USB dongle) for ADT 680W gauge.



15 Appendix I- Data logging

Data logging introduction

- (1) Push and hold 🕎 button to access to menu setup mode and move to log function.
- (2) If the data logging is ongoing, the gauge screen will show "ON" and the ticon, otherwise "OFF" will be shown.
- (3) Data logging menu structure as shown in the figure below

